


Perforated Metal Sheets


60° Staggered Round Holes

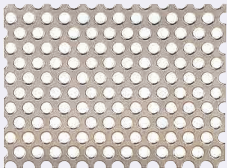

Type	Material	Surface Treatment
PMS	EN 1.0330 Equiv.	Nickel Plating
PMU	EN 1.4301 Equiv.	-
PMAL	EN AW-1100 Equiv.	-

RoHS10

AzB Positions of perforations and cut surface cannot be specified.

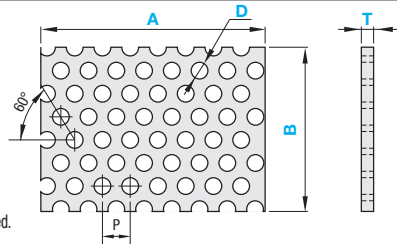

Part Number	1mm Increment		T Selection			PMS	PMU	PMAL	
Type	A	B	PMS	PMU	PMAL	P	Perforated Rate (%)		
PMS PMU	1	50~700	50~700	0.5 0.8	0.5 0.8	-	2	22.6	
	2			0.5 0.8 1.0	1.0	3	40.2		
	3					5	32.6		
	4			1.0 1.2 1.6	1.0 1.2 1.5	7	29.6		
	5					8	35.4		
	6			-	1.5	-	13	34.3	
PMAL	3					5	32.6		
	5	100~700	100~700	-	-	1.0	2.0	8	35.4
	9							15	32.6

PMS8 is not available. (PMU8 is selectable.)

1mm Increment	A	B	D1	D2	D3	D4	D5
50-100	50-100	50-100	T=0.5	T=0.8	T=1.0	T=1.2	T=1.6
101-200	101-200	101-200					
201-300	201-300	201-300					
301-500	301-500	301-500					
501-700	501-700	501-700					

1mm Increment	A	B	D1	D2	D3	D4	D5	D6
50-100	50-100	50-100	T=0.5	T=0.8	T=1.0	T=1.2	T=1.6	T=2.0
101-200	101-200	101-200						
201-300	201-300	201-300						
301-500	301-500	301-500						
501-700	501-700	501-700						

1mm Increment	A	B	D3	D5	D9
100-200	100-200	100-200	T=1.0	T=2.0	T=2.0
201-300	201-300	201-300			
301-500	301-500	301-500			
501-700	501-700	501-700			

Alterations Part Number - A - B - T - (XC, XWC, XAC, XBC)
PMS1 - 100 - 80 - 0.8 - XC4.5 - F50 - G40

Alteration is applicable to D1 and D2 only.

Alterations	Code	Spec.
4 Mounting Holes * Adds 4 mounting holes.	XC	XC, XWC = Hole Dia. Selection F, G = 1mm Increment Ordering Code XC4.5-F50-G40 XWC5.5-F35-G35 Hole Dia. Selection Table
8 Mounting Holes * Adds 8 mounting holes.	XWC	XC 4.5 5.5 6.5 9 XC+6≤F≤A-XC-6 XC+6≤G≤B-XC-6 XWC+6≤F≤A/2-XWC/2-3 XWC+6≤G≤B/2-XWC/2-3

Alterations	Code	Spec.
6 Mounting Holes * Adds 6 mounting holes in the A dimension direction.	XAC	XAC, XBC = Hole Dia. Selection F, G = 1mm Increment Ordering Code XAC4.5-F76-G55 XBC5.5-F90-G45 Hole Dia. Selection Table
6 Mounting Holes * Adds 6 mounting holes in the B dimension direction.	XBC	XAC 4.5 5.5 6.5 9 XAC+6≤F≤A/2-XAC/2-3 XAC+6≤G≤B-XAC-6 XBC+6≤F≤A-XBC-6 XBC+6≤G≤B/2-XBC/2-3

Perforated Metal Sheets


Perforated Metal Sheets with Rim

Fixed Dimension Perforated Metal Sheets



RoHS10

Type	Material	Surface Treatment
PMST	EN AW-5052 Equiv.	-
PMUT	EN 1.4301 Equiv.	-

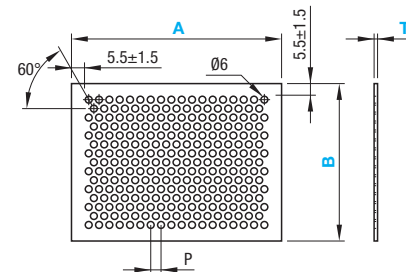

Part Number	Selection			Unit Price	P	Perforated Rate (%)
Type	A	B	T			
PMST	200	300	0.3		9	40.3
	300	400				
PMUT	200	300	0.6			
	300	400				

Ordering Example Part Number - A - B - T
PMUT - 200 - 300 - 0.6

Alterations Part Number - A - B - T - (XC, XWC, XAC, XBC)
PMUT - 200 - 300 - 0.6 - XC6.5 - F180 - G280

Alterations	Code	Spec.
4 Mounting Holes * Adds 4 mounting holes.	XC	XC, XWC = Hole Dia. Selection F, G = 1mm Increment Ordering Code XC4.5-F50-G40 XWC5.5-F35-G35 Hole Dia. Selection Table
8 Mounting Holes * Adds 8 mounting holes.	XWC	XC 4.5 5.5 6.5 XC+6≤F≤A-XC-6 XC+6≤G≤B-XC-6 XWC+6≤F≤A/2-XWC/2-3 XWC+6≤G≤B/2-XWC/2-3

Alterations	Code	Spec.
6 Mounting Holes * Adds 6 mounting holes in the A dimension direction.	XAC	XAC, XBC = Hole Dia. Selection F, G = 1mm Increment Ordering Code XAC4.5-F76-G55 XBC5.5-F90-G45 Hole Dia. Selection Table
6 Mounting Holes * Adds 6 mounting holes in the B dimension direction.	XBC	XAC 4.5 5.5 6.5 XAC+6≤F≤A/2-XAC/2-3 XAC+6≤G≤B-XAC-6 XBC+6≤F≤A-XBC-6 XBC+6≤G≤B/2-XBC/2-3

Example

For water/oil draining

